MARYLAND GEOLOGICAL SURVEY Merryman Hall The Johns Horkins University Baltimore, Maryland 21218 (301) 235-0771

COUNTIES (MD/PA)	WASHINGTON/FRANKLIN
M&D milestone no	111 (115)
MHT-HSI no.	WA-V-212

PROTECTED EXIDANGERED MISSING

FIELD SHEET: MASON & DIXON LINE, MARYLAND-PENNSYLVANIA BOUNDARY MARKER SURVEY

St. Paul's Church Rd with Fairview Rd) called Dry Run, at point about 1200' due W of the William O. Ditto house W/S Strite Rd; in/hedgerow separating grassy field (E/S) from cultivated field (W/S); about 5" W of old wire fence. Cannot be seen from DIRECTIONS TO SITE: From M&D 110 (114): continue W about 1.15 mile on Fairview Rd (MD 494) to intersection of Strite Rd/St.: Paul's Church Rd; turn sharp right (NNE) & follow about 0.7 mile to William O. Ditto house on W/S (new red brick 1-story; old white frame DESCRIPTION/MEASUREMENTS: original/reotation/traplacement/date 1767; squared colitic limestone post; standing about 1½ above ground; P on N/S, M on S/S; USC&GS disk N face (PA): 124" wide xy21" high; prolear & intact; circle panel, fluting & margins remain; small chips all edges & corners; big chip top NE corner E face: 124" wide x 10" high; most fluting & margins remain, but weatherworn

S face (MD): 12" wide x 171/2" high; M clear & intact; most of circle panel, fluting

& margins remain, but weatherworn; small chips all edges & corners 121/4" wide x 22" high; fluting & margins remain but very weatherworn, W face: scarcely discernible top:

planes barely discernible, weatherworn, no fluting remains; USC&GS disk set in apex & most of top smeared with cement. USC&GS triangulation station DITTO (1935), disk

bench mark:

CONDITION OF MARKER/FOUNDATION: : : exceldently good/fair/datakiakatad/kuine/unexposed 1900-03 Resurvey notes (order no.115), as in MGS Vol. 7, 1908, p. 91

115. Milestone No. 111, M. & D., 1767. This monument was found in the door yard of a farmhouse near the western border of the Cumberland Valley. It was much out of line, and as the buildings and trees prevented it from being seen (over)

1950 Inspection notes (present order no.113, photo no.111) as in Bayliff, 1959, Appendix C, p. 106

115. Original monument in good condition; lettering fair but weathered.

1979-81 Inspection notes: order no. 111(115); photos/negatives/slides no.111(115) 111 (115). Original M&D milestone of 1767, relocated a short distance westward and reset 1902, in place, in good condition, on firm foundation. Letters clear but all surfaces quite weatherworn; most of top smeared with mortar; (over)

SURROUNDING PROPERTY OWNERS (MD/PA): names, addresses, phones tax map 8 , block , P. 22 , deed 505 / 552 , acres 88.30 William Q. Dittok , P. 23, deed 504/423, acres 12.34

Richard F. Segrest , acres , P. , deed

RECORDED BY: names, addresses, phones, dates Alice Martin 2/28/81 Phone: 301/472-2128 14308 Mount Ave., Phoenix, MD 21131 Assisted by Clyde E. Martin; pointed in right direction by William O. Ditto

Also see: reverse side X , B&W photos X , negatives X , color slides X , maps X MHT-HSI form , other

DIRECTIONS TO SITE, continued

/bank barn /across street). Park in drive & ask Mr. & Mrs. Ditto for permission to cross their land to inspect milestone. Go to board gate (just S of their house close to rd), climb over & walk/up to crest of gentle slope, N-S wire fence/hedgerow, & stone.

CONDITION OF MARKER/FOUNDATION, continued

1900-03 Resurvey notes: from either direction, it was thought advisable to locate it on the open ridge next to the westward. It stands in the line of a fence which crosses the boundary from north to south.

1979-81 Inspection notes:
USC&GS triangulation station DITTO (1935) disk set in apex. Two/wires around middle circumference noted in 1967 still in place.\* Protected by site.

### NOTES

The Dittos were very hospitable, and took us to the board fence to point us in the right direction. We neglected to ask what the two wires meant, but assume they indicated the true property boundary lines (corner), rather than where the N-S fence is, a few inches to the east. Gerald Sword had noted the wires in his letter to Ronald Shank (DNR Indian Springs Wildlife Management Area) 9/20/67. The stone is not cracked in any way, nor was it repaired so as to require binding of this sort.

## B&W PHOTOS/NEGATIVES

5x7 NW corner (1981.11.4), Alice Martin 2/28/81

5x7 SE corner (1981.6.36),

31/2x5 Closeup of top & USC&GS triangulation station disk (1981.11.2), Alice
Martin 2/28/81

3½x5 View E: from stone toward Ditto house & barn (1981.6.37), Alice Martin 2/28/81


# COLOR SLIDES

2x2 NW corner (1981.7.16), Alice Martin 2/28/81 2x2 SE corner (1981.7.12), "

### MAPS

USGS 7½' topographic quadrangle section 1900-03 Resurvey engineer's map (Plates XLI & XLII), updated MD tax map section

#### OTHER

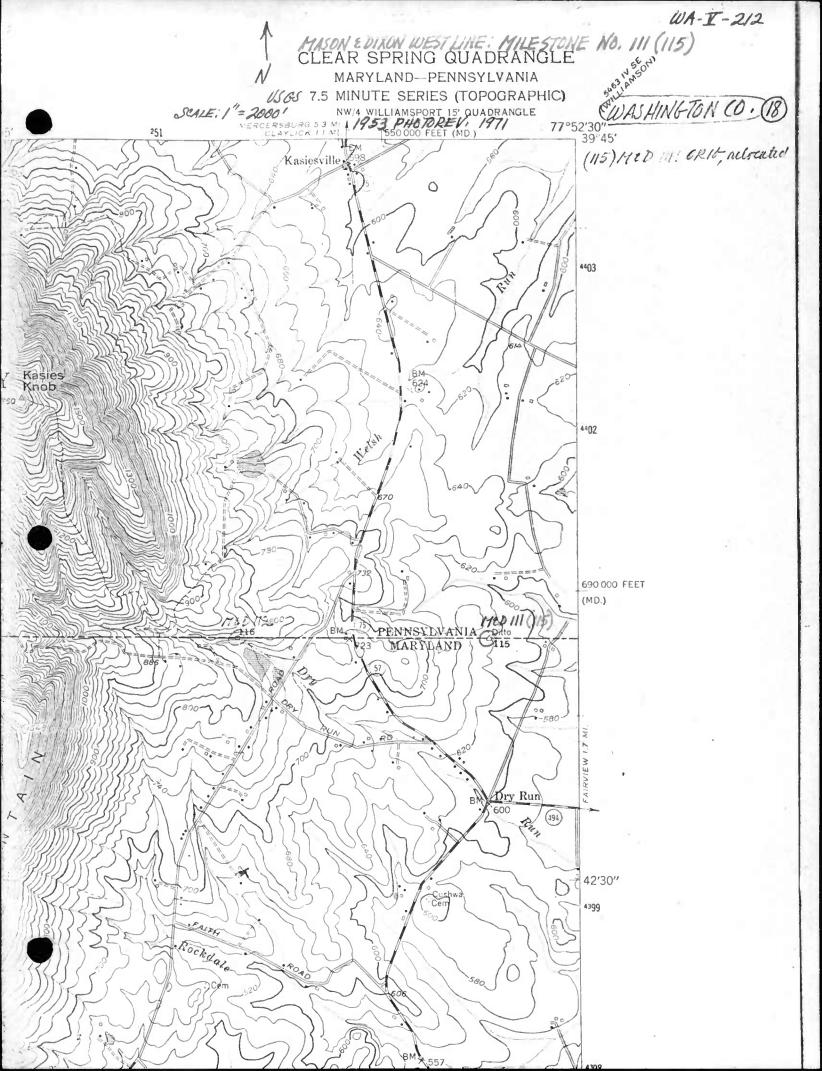



175 1-212 THON EN ON WISHING MILE STONE III (115) SE CORIER (19) PHOTO: ALICE MATTER (1981 6.30) 2/28/81



MA-I-212


MED WEST LAME INILESTANE III (IIS)

VIEW FROM STONE E TOWARD

DITTO HOUSE & BARN

PHOTO: ALICE HARTIN (1981.6.37)

2/28/81

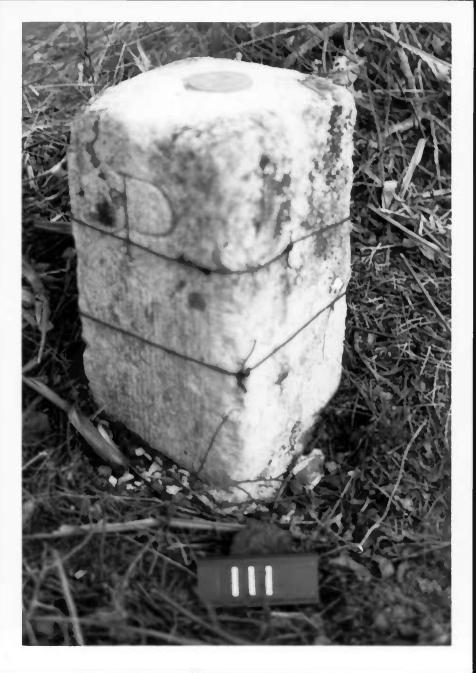

1765

016-T-2/2

MASONS DIXON WEST LINE! MILESTONE III (115)

PHOTO: ALICE MARTIN 2/28 81 (1021.11.4)



WA-I-212 MES HED WEST LINE: MILESTONE 111 (115) CLOSENP OF "DITTO" TRIANGULATION

STATION DISK

PHOTO: ALICE MARTIN 2/28/81 (1981.11.2)